



# TECH TIP 010

E2/TT010 v1.0  
2014/12

## T43016 / T43017

VAG 1.8 PETROL

Tensioners T43016 (Fig. 2) and T43017 (Fig. 1) are used in combination with Timing Belt 5491XS.

Although both tensioners look identical at first sight, they are not interchangeable.

The difference is to be found in the orientation of the attacking arm, which differs by 3°.

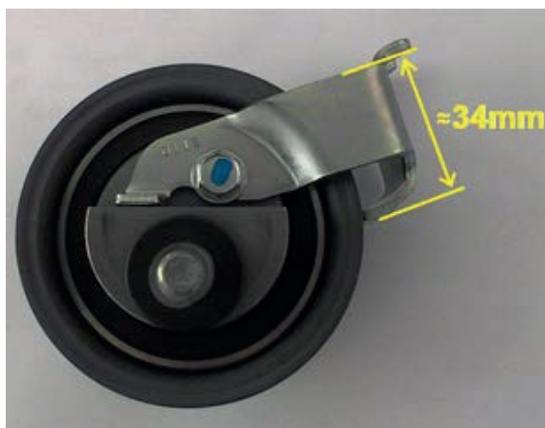


FIG. 1

The T43016 and T43017 are not interchangeable. Failure to use the appropriate kit and tensioner for this application will lead to incorrect tension. Premature belt failure and severe engine damage are inevitable consequences.



FIG. 2